

Járm információ

Rendszámtábla:LKF957

v:2011

Gyártó:Volvo

Modell:S60

VIN:YV1FS7051B2033642

Mérőteljesítmény:232617 km

Járm szoftver verziószáma:V44.89

Diagnosztikai alkalmazás verziószáma:V1.00.003

Diagnosztikai útvonal:Automatically Search > System Selection > DIESEL ENG (Fuel System/Combined System)



Data Stream

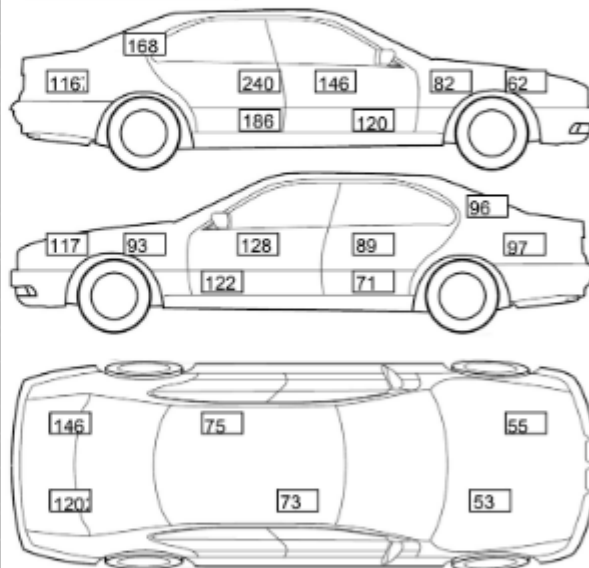
Név	rték	Egység
A/C Relay Status	Not Activated	
A/C-Pressure	8530	hPa
Absolute Throttle Position	89.41	%
Accelerator Pedal Position (Via CAN)	8.24	%
Accelerator Pedal Position, PWM	7.84	%
Air Flow Rate From Mass Air Flow Sensor	52.67	kg/h
Air Mass Desired	232.80	mg/stroke
Air Mass/Stroke	483.50	mg/stroke
Alternator, Current	28.89	A
Barometric Pressure	990	hPa
Boost Pressure Sensor	1026	hPa
Boost Pressure, Desired Value	1052	hPa
Brake Light Switch	Not Activated	
Clutch Pedal Switch	0	
Control Module Voltage	14.74	V
Current Through Fuel Pressure Regulator Valve	845	mA
EGR Valve, Commanded Position	0	%
EGR Valve, Position Sensor	1.95	%
Engine Coolant Temperature	80	degree C
Engine Cooling Fan, Commanded	7	%
Engine Oil Temperature	83.26	degree C
Engine Speed	742	rpm
Fuel Pressure	348200	hPa
Fuel Pressure, Nominal Value	350000	hPa
Fuel Temperature Sensor	36.36	degree C
Glow Plug, Commanded	0	%
Intake Air Temperature (MAF)	33	degree C
Intake Air Temperature (TMAP)	27.56	degree C
Intake Manifold Absolute Pressure Sensor	1005	hPa
Lambda	0	
Outdoor Temperature	19	degree C
Particulate Filter Pressure Sensor	11	hPa
Soot Mass In Particulate Filter	16.9	g
Temperature Sensor, Catalyst	122.06	degree C
Temperature Sensor, Particulate Filter	131.36	degree C
Vehicle Speed (Via CAN)	0	km/h

Külső állapot

Fényezés állapota:	Kiváló	
Hézagok:	Jók	
Üvegek:	Gyári	
Nyúlványok:	Épek	
Alváz:	> Válassz!	
Első lámpák:	Jó	Hátsó lámpák: Jó
Első gumik:	Hankook Nyári DOT 18, 30-40%	Hátsó gumik: Hankook nyári DOT 18, 30%
Pótkerék:	Defektjavító	Csomagtartó: Rendben

Fék, futómű

Első féktárcsa:	75 %	Első fékbetét:	75 %
Hátsó fék:	Féktárcsa		
Hátsó féktárcsa:	75 %	Hátsó fékbetét:	75 %
Futómű:	Korának megfelelő állapotú		

Festékréteg vizsgálat**Motortér**

Olajfolyás:	Nincs folyás
Hosszbordás szij:	Használt, de megfelelő
Motorolaj:	Szinten
Szervóolaj:	Szinten
Fékfolyadék:	Szinten
Hűtőfolyadék:	Szinten
Hűtő állapota:	Jók
Hűtőrendszer nyomás:	Jó
Motor járása:	Egyenletes
Kipufogó füstölés:	Normális

Műszeres vizsgálat, élő adatok

Rendben

Értékelés

Korához képest kitűnő karbantartott állapotú autó.. A jobb hátsó sárvédő/ív jh ajtó alja volt fényezve. Hátsó ajtó és a lökhárító szintén volt javítva.
Bal első fényszóró cserélve (gyári Valeo) . Felső motortartó bak részben szakadt.
Mégvétele javasolt autó.

14:17

Akcio vizsgaja

VOLVO V44.89 > Automatically Search > System Selection > DIESEL ENG... 14.6

Név	Érték	Egység
Fuel Quantity Correction Cylinder 1	-0.28	mg/cyc
Fuel Quantity Correction Cylinder 2	-0.76	mg/cyc
Fuel Quantity Correction Cylinder 3	0.67	mg/cyc
Fuel Quantity Correction Cylinder 4	-0.79	mg/cyc
Fuel Quantity Correction Cylinder 5	1.16	mg/cyc

14:18 92%

Akcio vizsgaja

VOLVO V44.89 > Automatically Search > System Selection > DIESEL ENG... 14.62V

Név	Érték	Egység
Engine Speed Cylinder 1	1470	rpm
Engine Speed Cylinder 2	1476	rpm
Engine Speed Cylinder 3	1468	rpm
Engine Speed Cylinder 4	1469	rpm
Engine Speed Cylinder 5	1470	rpm